

LAND CORNER RECORD

Index: V-16	Corner: E1/16 Corner between Sections 27 and 34	State of Indiana - Hoosier National Forest		
Section: 27	Township: 7N	Range: 1E	P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1369144.852	Long./E: 3149189.741	Datum: NAD83 IN West Zone, US Survey Feet	

CORNER HISTORY: (Chronological history of corner)


1.) Date of Survey:	Surveyor:	Monument:	Recording Information:	Monument Photograph:
8/3/1982	Ken Anderson L.S. #80040545	Monument set	USDA Forest Service Bedford, IN	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
Record evidence of prior survey:	No bearing trees noted.			
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
Record evidence of prior survey:				

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Beech*	18"	N02°W	29.68'
	White Oak*	21"	N75°E	10.21'
** = no markings * = old blaze at base of tree and no paint	Sugar Maple*	8"	S30°E	21.06'
	White Oak**	27"	S25°W	20.12'
Monument Found or Set:	An iron pipe with a 3" brass cap found 0.3' above grade.			

MONUMENT SKETCH


NARRATIVE REFERENCE:

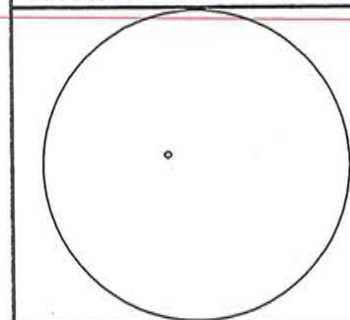

Monument is an iron pipe with a 3" brass cap found 0.3' above grade, a carsonite post is located 1.0' east of the monument, located on a western facing slope, +/- 40' west of the crest of a north-south running ridge, +/- 40' east of the edge of a steep slope heading to the west, +/- 500' north of St. Rd. 446, S60°W +/- 600' of a house, surrounded by mature forest, rock cairne at the base of the monument.

SECTION DIAGRAM

PERPETUATION RECORD:

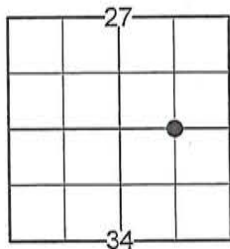

Corner Location = ●

The record monument was found undisturbed and maintained by remarking three existing bearing trees and establishing one new bearing tree. Three existing bearing trees were recovered from an unknown source. Anderson did not have any notes on the existing bearing trees recovered.

Three bearing trees were marked with a bearing tree sign and mag nail.

Referenced on BRCJ survey recorded as InstNo.2018007752
Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

Section: 27 T7N R1E

Prepared By: BRCJ (Project#3-0822) Date: 5/2018